

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

CHILD SEATS:

None during February 2013.

EQUIPMENT:

Hodyon, Inc. is recalling certain Dynasys Auxillary Power Units (APU) distributed between October 2009 and December 2012. The wire that connects the APU to the heating, ventilation and cooling (HVAC) unit may be under-rated for the electrical current. If the wire becomes bent or kinked, it may have reduced current carrying capacity resulting localized overheating. If flammable materials are near the overheated wire, there is an increased risk of fire and personal injury. Hodyon has sent interim notification letters to the affected customers, and dealers will rewire the affected electrical components going to the HVAC system. The recall began on February 19, 2013. Owners may contact Hdynasys Customer service at 1-800-289-8282 ext 3. Hodyon's recall campaign number is TSB-01242013.

13E-006

Fulmer Helmets, Inc. (Fulmer) is recalling certain motorcycle helmets, models AF-80, AF-81, and AF-82, sizes medium, large, XL, and 2XL. During testing, the affected helmets fail to conform to the impact attenuation, penetration, labeling, and retention requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Fulmer will replace any helmet or offer a reimbursement for any noncompliant helmet. The recall is expected to begin during March 2013. Owners may contact Fulmer toll-free at 1-800-489-2300.

13E-007

Yakima Products, Inc. (Yakima) is recalling certain SpareTime, two bike, rack systems, part number 8002598, manufactured from November 1, 2011, through October 30, 2012. These racks are for use on vehicles with a rear hatch door mounted spare tire system. The affected bike racks have mounting bolts that may break. If the mounting bolts break, the bike rack may fall from the vehicle, possibly becoming a road hazard to other vehicles or causing injury to pedestrians. Yakima will notify owners and mail replacement bolts with instructions to owners, free of charge. The safety recall began on February 22, 2013. Owners may contact Yakima at 1-888-925-4621.

13E-008

Zhejiang Jixiang Motorcycle Fittings Co., Ltd. (Zhejiang) is recalling certain motorcycle half helmets, model JX-B210, sizes Large and XL, manufactured in 2008. During testing, the affected helmets failed to conform to the impact attenuation, penetration, labeling, and retention requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Zhejiang will recall the helmets. The recalled helmets are no longer produced by the manufacturer. Zhejiang does not have the end user information. As such, owner notifications will not be sent. Owners may contact their US agent, Precision Global Resource, LLC at 1-909-638-9040. A remedy plan has not been provided.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

13E-009

Quadratec, Inc. is recalling certain aftermarket accessory, driver-side, Ultimate Floor Liners part numbers 14254.0301 07, 14254.0301 08, 14254.0301Q, 14254.0302 07, 14254.0302 08, 14254.0302Q, 14254.0303 07, 14254.0303 08, 14254.0303Q, 14254.0309 07, 14254.0309 08, and 14254.0309Q sold from May 1, 2012, through February 14, 2013. The liners are for use in 2007-2013 Jeep Wranglers. The anchor point for the affected floor liners may tear during use, particularly when exposed to high temperatures. The tearing may allow the floor liner to shift forward. If the liner shifts forward it may impede the operation of the accelerator and possibly lead to unintended acceleration, which may increase the risk of a crash. Quadratec will notify owners and either exchange the liners or provide them with a hook guard kit to help secure the driver-side mat, free of charge. The recall is expected to begin in March 2013. Owners may contact Quadratec at 1-800-463-2998 or info@quadratec.com. This recall only affects Quadratec floor liners and is not being conducted by Chrysler/Jeep. Quadratec's recall campaign number is 13-01.

13E-010

Robert Bosch LLC (Bosch) is recalling certain Hydro-Max brake master cylinders with 2.0 inch bore and 84 cubic inch reservoir equipped with a brake fluid level indicator switch and without a differential pressure switch, manufactured between July 1, 2011 and April 12, 2012. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. If the brake system develops an external leak, it may result in a loss of brake fluid below the detection level of the fluid indicator switch. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash. Bosch will notify customers and replace the fluid level indicator switch free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact the Bosch Technical Support and Warranty Hotline at 1-855-426-7247.

13E-011

Meritor, Inc. is recalling certain axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Meritor will notify owners and will inspect the affected brake chambers, and replace them as needed, free of charge. The safety recall is expected to begin March 19, 2013. Owners may contact Meritor at 1-866-668-7221. Meritor's campaign recall is C-13AA.

13E-012

Progressive Dynamics, Inc. is recalling certain ALL-IN-ONE Power Converter Models PD 4560 and PD 4590 manufactured January 14, 2013, through February 8, 2013 with serial number prefixes of A 13014 through A 13039. The affected power converters, used in recreational vehicles to supply A/C power, have internal components that may short circuit. A short circuit may lead to a vehicle fire. Progressive Dynamics will notify purchasers and will supply and replace the affected internal components, free of charge. The recall began on February 21, 2013. Customers may contact Progressive Dynamics at 1-269-781-4241.

13E-013

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

TIRES:

Hercules Tire & Rubber Company (Hercules Tire) is recalling certain Hercules ALL TRAC A/T 10-ply Load Range E tires, sizes LT215/85R16 115/112S, DOT Serial Numbers JEHMECL5008-4010; LT235/85R16 120/116S, DOT Serial Numbers JEKMECL4708-4010; LT245/75R16 120/116S DOT Serial Numbers JEJKECL4608-4010; LT265/75R16 123/120S, DOT Serial Numbers JENKECL4808-4010; LT265/70R17 121/118S, DOT Serial Numbers JENJFCL5108-4010; LT245/75R17 121/118S, DOT Serial Numbers JELKFCL5008-4010 and LT225/75R16 115/112S, DOT Serial Numbers JEJKECL5108-4010. These tires can experience in-service belt and tread separations. Should a separation occur, the driver could lose control of the vehicle without warning, which could increase the risk of a vehicle crash. Hercules Tire will notify owners and replace the affected tires free of charge, including mounting and balancing. The recall began on February 27, 2013. Owners may contact Hercules Tire at 1-888-965-5795 or by email: alltracresponse@HerculesTire.com for more information. Owners may contact Hercules Tire at 1-419-425-6400 for more information. Hercules Tire's recall campaign number is 01-2013.

13T-002

VEHICLES:

Yamaha is recalling certain model year 2009 YW125 (Zuma 125) scooters manufactured between July 2008 and April 2009 due to possible improper clearances in the internal fuel pump components. These improper clearances may cause an inadequate supply of fuel. The limited fuel supply could cause engine stalling, increasing the risk of a crash. Yamaha will notify owners, and dealers will replace the fuel pump with a newly designed fuel pump. The recall began on February 27, 2013. Owners contact Yamaha at 1-800-962-7926.

13V-035

Blue Bird Corporation is recalling certain model year Ultra LF transit buses manufactured March 14, 2003, through March 12, 2007. Cracks may develop in the bracket which secures the power steering gear to the bus frame. If left unchecked, the cracks may propagate and cause a separation of the steering gear from the bus frame. This would result in a loss of steering control, possibly increasing the risk of a vehicle crash. Blue Bird will notify owners, and dealers will install reinforcement plates, free of charge. The recall is expected to begin March 18, 2013. Owners may contact Blue Bird at 1-478-825-2021. Blue Bird's recall campaign number is R13WA.

13V-036

Forest River is recalling certain model year 2013 Concord, Leprechaun, Freelanders, Lexington, Forester and Sunseeker class B and class C motor homes built on Chevrolet Express and GMC Savana chassis. It may be possible to remove the key from the ignition when the vehicle is running or the transmission is not in the Park position. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard 114, "Theft Protection." If the ignition key is removed while the vehicle is still on and/or the vehicle is not in Park, the vehicle may rollaway and the unintended movement of the vehicle may result in a possible crash or injury to pedestrians. General Motors (GM) will notify owners on behalf of Forest River. GM dealers will replace the ignition lock cylinder and the two associated keys. This service will be performed free of charge. The recall

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

began on February 28, 2013. For more information, GMC owners may call 1-866-996-9463 and Chevrolet owners may call 1-800-630-2438. Owner's may also contact Forest River at 1-574-389-4600.

13V-037

Chrysler is recalling certain model year 2009-2012 Ram 1500 trucks manufactured from February 27, 2008, through June 30, 2009, and from December 1, 2009, through October 20, 2011; model year 2009-2011 Dodge Dakota trucks manufactured from February 27, 2007, through June 30, 2009, and from December 1, 2009, through September 30, 2011; model year 2009 Chrysler Aspen trucks manufactured from January 3, 2008, through December 18, 2008; and model year 2009 Dodge Durango trucks manufactured from January 3, 2008, through December 18, 2008. The rear axle pinion nut may loosen due to an undersized pinion spline that can allow relative motion between the nut and companion flange. If the rear axle pinion nut loosens, the axle can lock up and cause a loss of vehicle control and/or a vehicle crash with little warning. Chrysler will notify owners, and dealers will install a pinion nut retainer, free of charge. The recall is expected to begin during March 2013. Owners may contact Chrysler at 1-800-247-9753. This campaign is an expansion of a recall campaign 12V-474. Chrysler's recall campaign number is N08.

13V-038

Prevost is recalling certain model year 2008-2013 X3-45, H3-41 and H3-45 coaches, model year 2011-2013 H3-45 VIP coaches, model year 2012-2013 X3-45 VIP coaches, and model year 2009-2013 XLII-45 Entertainer coaches manufactured from May 16, 2007, through February 6, 2013 and equipped with Volvo engines. Certain conditions may cause the affected coaches to go into a software mode that would result in the throttle signal being fixed at 1700rpms regardless of throttle pedal input from the driver. Uncontrollable throttle position may lead to a loss of vehicle control, increasing the risk of a crash. Prevost will notify owners and dealers will remedy will the affected coaches, free of charge. A notification schedule has not been provided. The Prevost recall campaign number is SR13-07.

13V-039

Chrysler is recalling certain model year 2003 and 2004 Dodge Viper vehicles manufactured from November 1, 2001, through June 30, 2004. A component in the air bag control module may fail causing the front airbags and/or seatbelt pretensioners to deploy inadvertently while the vehicle is being operated. Inadvertent deployment of the airbags and/or seat belt pretensioners could increase the risk of personal injury and the possibility of a crash. Chrysler will notify owners, and dealers will repair the vehicles free of charge. An interim notification is expected to be sent on March 22, 2013. The remedy is expected to be available later in the year. Owners may contact Chrysler at 1-800-853-1403. Chrysler's recall campaign number is N13.

13V-040

Lotus is recalling certain model year 2007-2008 Elise and Exige vehicles manufactured from December 1, 2006, through October 31, 2007. The oil cooler line may become detached from its fitting. A detached oil line could spray oil on a tire, increasing the risk of a crash, or it could spray oil throughout the engine compartment increasing the risk of a fire. Lotus will notify owners, and dealers will replace the oil cooler hose fittings and the entire lateral oil cooler hose, free of charge. The safety recall began on March 4, 2013. Owners may contact Lotus at 1-800-245-6887. Lotus' number for this recall is 2013/01R.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

13V-041

Fontaine Modification is recalling certain model year 2011-2013 Navistar International 4300, 4400, 7300, 7400, and 7500 trucks; manufactured January 1, 2011 through January 9, 2013 and were modified to be able to be steered from either front seat. Certain steering assembly retaining clips may not be completely engaged, resulting in the clips coming loose. Without a retaining clip, the steering may feel "loose" and be unresponsive which may increase steering difficulty and the likelihood of a vehicle crash. Fontaine will notify owners and dealers will inspect each truck's steering cross shaft assembly. Any that are found defective will have the complete steering cross shaft assembly replaced, free of charge. Owners may contact Fontaine at 1-800-366-8246.

13V-042

Chrysler is recalling certain model year 2013 Chrysler 200 and Dodge Avenger vehicles manufactured from October 30, 2012, through November 2, 2012. These vehicles may have a gas tank that has a broken control valve in the fuel tank assembly. A broken control valve in the fuel tank assembly may lead to an engine stall or fuel leakage. An engine stall while driving may contribute to a vehicle crash. Fuel leakage, in the presence of an ignition source, may result in a fire. Chrysler will notify owners, and dealers will inspect the fuel tank assembly and replace any affected control valves, free of charge. The recall is expected to begin during March 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N02.

13V-043

BMW is recalling certain model year 2008-2012 1-Series coupes and convertibles manufactured December 2007 through July 2011; and 2007-2011 3-Series coupes and convertibles manufactured March 2007 through July 2011; 2007-2011 3-Series sedans manufactured March 2007 through October 2011; 2007-2011 3-Series sports wagons manufactured March 2007 through June 2011; and 2009-2011 Z4 vehicles manufactured March 2009 through June 2011. The connector for the positive battery cable connector and the corresponding terminal on the fuse box may degrade over time. Over time, the high current flow and heat from electrical resistance may lead to a breakage of the connection, and a loss of electrical power to the vehicle. If there is a loss of electrical power to the vehicle, the vehicle may unexpectedly stall, increasing the risk of a crash. BMW will notify owners, and dealers will replace the positive battery cable connector and secure it with an improved method, free of charge. The recall is expected to begin in March 2013. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13V-044

BMW is recalling certain model year 2007-2010 X5 SAV vehicles, manufactured September 12, 2006, through March 18, 2010 and equipped with an 8-cylinder engine. The brake vacuum pump may leak a small amount of lubricating oil into the hose. The contamination could result in a loss of power assist braking. The loss of power assist in braking could increase stopping distance and lead to a vehicle crash. BMW will notify owners, and dealers will replace the brake vacuum line with one that contains a check valve, free of charge. The recall is expected to begin during March 2013. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13V-045

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

Spartan is recalling certain model year 2005-2011 RMP 100 and 2008-2010 MMP 100 aerial vehicle apparatus. These vehicles are equipped with a single platform inclinometer that may provide an intermittent signal allowing the platform to be tilted more than below the horizontal plane. The intermittent signal may allow the aerial platform to be tilted more than below the horizontal plane which could allow the platform to strike nearby objects or people increasing the risk of injury or property damage. Spartan will notify the owners, and dealers will replace the single inclinometer with a dual inclinometer installed in a sealed enclosure, free of charge. The recall began on February 25, 2013. Owners may contact Spartan at 1-800-867-6478, Option 2. This is Spartan recall number ERV13-002.

13V-046

Rolls-Royce Motor Cars is recalling certain model year 2013 Phantom vehicles manufactured from November 2, 2012, through January 18, 2013. The fuel filler necks may be missing the anti-misfueling devices. The devices prevent misfueling and discharge static electricity. Without the anti-misfueling device, there is an increased risk of fire from static electricity. Rolls-Royce is presently contacting all affected owners. Dealers will inspect the gas tank and replace any affected fuel filler necks, free of charge. The recall began in early February 2013. Owners may contact Rolls-Royce at 1-877-877-3735.

13V-047

PACCAR is recalling certain model year 2013-2014 Kenworth T680 and T880 trucks, manufactured from January 18, 2012, through February 1, 2013; and model year 2013-2014 Peterbilt 579 and 567 vehicles, manufactured from January 20, 2012, through January 31, 2013. The Exterior Lights Self-Test switch is intended to be used when the vehicle is parked. If the switch is pressed while the vehicle is in motion, the Exterior Lights Self-Test switch will cause all exterior lighting to be extinguished. An unexpected loss of lighting during vehicle operation may reduce the driver's ability to see other vehicles, pedestrians, or objects, as well as reduce the truck's visibility to other drivers or pedestrians, increasing the risk of crash. PACCAR will notify owners, and dealers will disable the Exterior Lights Self-Test software parameter and remove the Exterior Lights Self-Test switch and install a switch plug in its place. The services will be offered free of charge. The recall began on February 28, 2013. Owners may contact Kenworth at 1-425-828-5000 or Peterbilt at 1-940-591-4000. The exterior lights will re-illuminate if the switch is pushed again. Kenworth's recall campaign number is 13KWB. Peterbilt's recall campaign number is 0213-B.

13V-048

Spartan ERV is recalling certain model year 2008-2009 RMA 75, RMA 103, and TDA aerial fire apparatus manufactured from April 04, 2008, through April 13, 2010 and equipped with hydraulic extension and retraction cylinders produced by RamRod Industries. The cylinders on the affected vehicles may have welded rod eyes that were not properly heat treated during the manufacturing process. An improperly manufactured rod eye end attachment may fracture or separate. In the event two affected cylinders are installed on the same aerial lift device, the aerial lift may retract without warning and cause severe injury and/or property damage. Spartan ERV will notify owners, and dealers will replace the affected cylinders, free of charge. The recall began on February 25, 2013. Owners may contact Spartan ERV at 1-800-867-6478, Option 2. Spartan's recall campaign number is ERV13-003.

13V-049

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

Keystone RV Company (Keystone) is recalling certain model 2013 Springdale 266RLSSR and 267BHSSR Travel Trailers, manufactured from November 19, 2012, through February 5, 2013. These vehicles were manufactured with the incorrect information on the Federal Identification Tag and Tire and Loading Information Label. The tire inflation pressure is incorrectly listed as 448 KPA (65 PSI) instead of 345 KPA (50 PSI). Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." Owners relying on the information contained on the label may overinflate the tires, which may result in sudden tire failure, which may increase the risk of a crash. Keystone will notify owners and provide corrected labels. The recall began on February 27, 2013. Owners may contact Keystone RV Company at 1-866-425-4369. Keystone's recall number is 13-189.

13V-050

Hyundai is recalling certain model year 2012 Veloster vehicles manufactured from July 4, 2011, through October 31, 2011 and equipped with panoramic sunroofs. The panoramic sunroof assembly may have been weakened during installation at the factory. If the assembly was weakened at the factory, the panoramic glass panel may break while the vehicle is in motion leading to personal injury or a vehicle crash. Hyundai will notify owners, and dealers will inspect the sunroof's integrity and replace the sunroof glass assembly, as necessary, free of charge. The safety recall will begin in March 2013. Owners may contact Hyundai at 1-800-633-5151. Hyundai's recall campaign number is 108.

13V-051

UD Trucks is recalling certain model year 2011-2013 UD2600 and UD3300 trucks equipped with Allison 3000RDS automatic transmissions. The oil cooler hose clamp retaining rings may fail. If the retaining ring fails, the oil cooler hose may leak, leaving a large deposit on the roadway, which may present a hazard to other vehicles. If any of the oil sprays onto hot engine components, there would be an increased risk of a vehicle fire. UD Trucks will notify owners, and dealers will replace the affected hoses free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact UD Trucks at 1-800-832-5929.

13V-053

Navistar is recalling certain model year 2011-2012 Workhorse Custom Chassis W42 and W62 vehicles, manufactured from July 18, 2011, through July 12, 2012, and equipped with hydraulic brakes. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash. Navistar will notify owners, and dealers will replace the FLI switch free of charge. The safety recall is expected to begin by April 22, 2013. Owners may contact Navistar at 1-800-448-7825. Navistar's recall campaign number is 13503.

13V-054

Prevost is recalling certain model year 1993 thru 2013 model H3-40, H3-41, H3-45, and H3-45 VIP Prevost coaches manufactured from December 1993 through February 12, 2013. Under certain conditions, the drag link collar position combined with an over torque of the collar retaining bolt may create a contact with the pitman arm. This contact may cause the turnbuckle to fracture without warning. If the drag link turnbuckle breaks while

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

the vehicle is in use, stability and vehicle control may be lost, increasing the risk of a crash. Prevost will notify owners, and dealers will inspect the vehicles and replace any affected drag link, free of charge. The manufacturer has not provided a notification schedule. Owners may contact Prevost at 1-418-883-2888. Prevost's recall campaign number is SR13-08.

13V-055

Daimler Buses North America (DBNA) is recalling certain model year 2011-2012 Orion VII transit buses equipped with disc brakes using MGM brake components. In the affected vehicles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. DBNA will notify owners and will replace the affected brake chambers, free of charge. The safety recall began on March 7, 2013. Owners may contact Daimler Buses North America at 1-800-882-8054.

13V-056

Porsche is recalling certain model year 2012-2013 911 Carrera and Carrera 4 vehicles manufactured from March 7, 2012, through November 12, 2012, and equipped with a standard (not sport) exhaust system. The exhaust tail pipe may fracture and separate from the rear muffler. If the exhaust tail pipe separates from the muffler it may become a hazard for other vehicles on the road, increasing the risk of a crash. Porsche will notify owners, and dealers will replace the rear mufflers free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche at 1-800-767-7243. Porsche's safety recall number is AD01.

13V-058

Northwood Manufacturing, LLC (Northwood) is recalling certain model year 2013 Arctic Fox 29-5K and 29-5T fifth wheel trailers; model year 2013 Desert Fox 29SB toy hauler trailers; model year 2013 Fox Mountain 235RLS and 285RLS fifth wheel trailers; and model year 2013 Snow River 266RDS travel trailers. These vehicles were manufactured with incorrect information on the Federal Identification Tag, Tire and Axle Information Label, and the Trailer Weight Information Label. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." An inaccurate label could lead to improper vehicle loading specifications which could cause axle failure which may result in an increased risk of a crash. Northwood will notify owners and provide corrected replacement labels free of charge. Northwood will mail labels on March 13, 2013. Owners may contact Northwood at 1-800-766-6274.

13V-059

Subaru is recalling certain model year 2010-2012 Legacy and Outback vehicles equipped with an automatic or CVT transmission and an Audiovox remote engine starter (RES) accessory, certain model year 2012-2013 Impreza vehicles equipped with a CVT transmission and an Audiovox remote engine starter (RES) accessory, and certain model year 2013 XV Crosstrek vehicles equipped with a CVT transmission and an Audiovox remote engine starter (RES) accessory. Additionally included are certain model year 2013 Legacy and Outback vehicles that may have received replacement RES fobs. If the RES fob is dropped, the fob may malfunction and randomly transmit an engine start request without pressing the button. The engine may inadvertently start and run

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

for up to fifteen minutes. The engine may continue to start and stop until the fob battery is depleted, or until the vehicle runs out of fuel. If the vehicle is parked in an enclosed area, there is a risk of carbon monoxide build-up which may cause headaches, dizziness or, in extreme cases, unconsciousness and/or asphyxiation. Subaru will notify owners, and dealers will replace the RES key fobs, free of charge. The recall is expected to begin by the end of April 2013. Owners may contact Subaru at 1-800-782-2783 for more information. Original equipment keyless entry fobs integrated on the vehicle key are not affected. Subaru's recall campaign number is WQF-42.

13V-061

Pierce is recalling certain model year 2007-2010 Velocity and Impel fire trucks manufactured from June 6, 2007, through October 30, 2010. The springs inside the inner door handles may allow the door to open inadvertently. If the door inadvertently opens while the vehicle is in motion, the occupants may fall out and suffer personal injury. Pierce will notify owners, and dealers will replace the inner door handles, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Pierce at 1-920-832-3000. Pierce's campaign recall number is 74B237.

13V-062

US Specs is recalling one 2002 Porsche Carrera, one 1997 BMW 750IL, and two 1986 BMW 635 CSI vehicles for failing to conform to Federal Motor Vehicle Safety Standard No. 111, "Rearview Mirrors." While performing conformity-related modifications for the US market, labels with an incorrect size font were applied to the passenger side mirror. Drivers of these vehicles may not know the proximity of the objects in the passenger side mirror, increasing the risk of a crash. US Specs will notify owners and correct the statement on the passenger mirror of the affected vehicles, free of charge. The recall is expected to begin in March 2013. Owners may contact US Specs at 1-443-502-2331. US Specs campaign recall number is MR101.

13V-063

US Specs is recalling one 2002 Porsche Carrera 911. This vehicle fails to conform to Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." After performing conformity-related modifications for the US market, this vehicle was released with passenger seatbelts that lack the required Automatic Locking Retractor (ALR) function. Without the ALR function, the seatbelts do not allow for the secure installation of a child restraint, which can increase the risk of injury to a child during a crash. US Specs will notify the owner and replace all of the passenger seat belts, free of charge. The recall is expected to begin in March 2013. Owners may contact US Specs at 1-443-502-2331. US Specs' campaign recall number is SB101.

13V-064

Keystone is recalling certain model year 2013 Montana Fifth Wheel vehicles manufactured January 16, 2013, through February 18, 2013; and 2013 Fuzion Fifth Wheel vehicles manufactured January 22, 2013, through February 18, 2013. These vehicles are equipped with Progressive Dynamics power converters with serial number prefix A13014 through A13039. The converters have a internal components that may short circuit. A short circuit may result in a fire. Keystone will notify owners, and dealers will replace the affected internal components of the power converter, free of charge. The recall will begin in March 2013. Owners may contact Keystone Customer Service by calling 1-866-425-4369. Keystone's recall campaign number is 13-191.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING FEBRUARY 2013

Published March 12, 2013

13V-065

Spartan Motors Chassis, Inc., a subsidiary of Spartan Motors, is recalling certain model year 2012-2013 Metro Star and Gladiator fire trucks manufactured from March 29, 2012, through January 30, 2013 and equipped with a Spartan advanced protection system (APS) supplied by Takata Protection Systems. The circuits on the control module of the APS may short and cause an inadvertent air bag deployment. An inadvertent air bag deployment could result in personal injury or increase the risk of a crash. Spartan Motors will notify owners, and dealers will install a new sub-wire harness on the control module of the APS, free of charge. The recall is expected to begin in March 2013. Owners may contact Spartan at 1-800-543-5008 - Option 4. Spartan's recall campaign number is 13-004.

13V-066

Supreme Corporation (Supreme) is recalling certain model year 2006-2012 Startrans Trolley, Sentinel, Senator HD, Senator, Candidate, C2, S2, PS2, and President transit buses equipped with Ricon manufactured wheelchair lifts which have an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. The cable may contact the power lug at the base of the wheel chair lift causing a short circuit that could result in a fire. Ricon will be conducting this recall on behalf of Supreme. Ricon will notify the affected owners and will provide a supplemental cover kit and instructions, free of charge. This recall campaign is expected to begin during March 2013. Owners may contact Supreme at 1-800-642-4889 or Ricon at 1-818-267-3000.

13V-067

Fontaine Trailer Company, dba Fontaine Heavy-Haul, is recalling certain model year 2013 Renegade LX40 and LXT40 lowbed trailers manufactured between August 2012 and November 2012. The combo eye plate that connects the gooseneck portion of the trailer to the deck portion of the trailer may crack and ultimately fracture and thereby fail to maintain the load carrying capabilities as designed. In the event of a combo eye plate crack and failure, the deck of the trailer could tilt and impact the highway, stopping the vehicle unexpectedly, increasing the risk of a crash. Fontaine Heavy-Haul will notify owners, and dealers will inspect and replace any defective components free of charge. The recall began on March 11, 2013. Owners may contact Fontaine Heavy-Haul at 1-866-382-7278, option 2, ext. 819.

13V-076

Supreme Corporation (Supreme) is recalling certain model year 2009-2010 Startrans MFSAB school buses equipped with Ricon manufactured wheelchair lifts which have an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Ricon will be conducting this recall on behalf of Supreme. Ricon will notify the affected owners and will provide a supplemental cover kit and instructions, free of charge. This recall campaign is expected to begin during March 2013. Owners may contact Supreme at 1-877-258-1391 or Ricon at 1-818-267-3000.

13V-083